

DATE

SECRET

TO :

FROM :

ACTION:

INFO :

IN 56525

25X1A

OPS-10 *N*

1	9
2	10
3	11
4	12
5	13
6	14
7	15
8	16

TO

INFO

CITE

SECRET 190651Z CITE [REDACTED] 7144

PRIORITY [REDACTED]

25X1A

25X1A

25X1A

REF A: [REDACTED] 7044

B: [REDACTED] 7032

C136C

1. IN REF A, SYSTEM 3 AND P BAND OF SYSTEM 6 WERE DEAD DUE TO FAILURE OF THEIR COMMON HRB PREAMP. FRONT END TRANSISTORS 2N2999 OF PREAMP WERE DEFECTIVE.

25X1A

2. IN REF A AND B [REDACTED] WAS UNSATISFACTORY BECAUSE THE ANTENNA TUNER FOR THE 618-T WAS DEFECTIVE. TUNING ACTION WAS ERRATIC AND INTERMITTANT ON POST FLIGHT RAMP CHECKS. CONDITIONS COULD NOT BE DUPLICATED ON BENCH SETUP. THE TUNER HAS BEEN REPLACED.

3. THE DICTET RECORDERS WERE APPROX 50 PERCENT READABLE DUE TO SPEED VARIATIONS.

SECRET TOR 190710Z MAY 66

EDD
PH
RP
KB
DB
AF
NM
DJ

SECRET

GROUP 1
EXCLUDED FROM AUTO-
MATIC DOWNGRADING
AND DECLASSIFICATION